




**Willamette Temperature Control
McKenzie River Sub-Basin, Oregon**

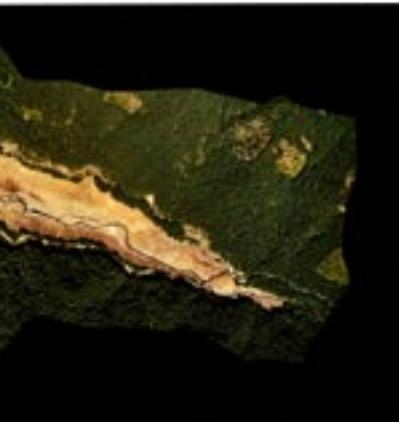

Cougar Dam and Reservoir

Draft Supplemental Information Report



**US Army Corps
of Engineers®
Portland District**

January 2003

Cover photo: Aerial photograph of Cougar Reservoir with residual pool at 1,400 foot elevation. Fall 2002.
Blue “river” is South Fork McKenzie channel location, pre-dam.

DRAFT
SUPPLEMENTAL INFORMATION REPORT
WILLAMETTE TEMPERATURE CONTROL
MCKENZIE RIVER SUB-BASIN, OREGON
COUGAR DAM AND RESERVOIR

U.S. Army Corps of Engineers
Portland District

January 2003

DRAFT
SUPPLEMENTAL INFORMATION REPORT
WILLAMETTE TEMPERATURE CONTROL
MCKENZIE RIVER SUB-BASIN, OREGON
COUGAR DAM AND RESERVOIR

TABLE OF CONTENTS

	Page
1.0 <u>INTRODUCTION</u>	1
2.0 <u>BACKGROUND</u>	2
2.1 <u>Project Authorization</u>	3
2.2 <u>Construction</u>	3
3.0 <u>ENVIRONMENTAL COMPLIANCE TO DATE</u>	3
3.1 <u>National Environmental Policy Act Analysis</u>	3
3.2 <u>Clean Water Act Analysis</u>	3
3.2 <u>Biological Assessment/Biological Opinion</u>	4
4.0 <u>DESCRIPTION OF THE ACTION TO DATE</u>	4
4.1 <u>Diversion Tunnel Construction</u>	4
4.2 <u>Tunnel Tap</u>	4
4.3 <u>Drawdown</u>	4
4.4 <u>Intake Tower Construction</u>	4
4.5 <u>Environmental Coordination Committee Meetings</u>	4
4.6 <u>Water Quality Monitoring</u>	4
4.6.1 <u>Pre-drawdown water quality</u>	6
4.6.2 <u>Drawdown water quality—turbidity</u>	7
4.6.3 <u>Drawdown water quality—other parameters</u>	9
4.6.4 <u>Summary</u>	10
4.7 <u>Fisheries Monitoring</u>	11
4.8 <u>Spotted Owl Monitoring</u>	12
4.9 <u>BMPs Implemented</u>	12
4.10 <u>Public Information Meeting</u>	13
5.0 <u>PROPOSED MANAGEMENT OPTIONS FOR REMAINING CONSTRUCTION</u>	13
5.1 <u>Discussion and Evaluation of Options</u>	13
5.2 <u>Preferred Option for 2003/2004</u>	15
5.2.1 <u>BMPs for Subsequent Drawdowns</u>	15
5.2.2 <u>BMPs After Drawdown</u>	15
5.2.3 <u>Operation of Blue River Reservoir</u>	15
6.0 <u>DESCRIPTION OF ACTIONS TO BE COMPLETED</u>	16
6.1 <u>2003 Drawdown and Construction</u>	16
6.1.1 <u>Water Quality Monitoring</u>	16
6.1.2 <u>Biological Monitoring</u>	16

6.2 2004 Drawdown and Construction	17
7.0 NEW CIRCUMSTANCES SINCE THE EARLIER NEPA DOCUMENT	17
7.1 Turbidity	17
7.2 Sedimentation	19
7.2.1 Erosion and Sediment Movement within Cougar Reservoir	19
7.2.2 Suspended Sediment Concentrations	20
7.2.3 Sediment Transport Analysis	21
7.3 Sediment Sampling & DDT	21
7.3.1 DDT in Sediment	21
7.3.1.1 June Events	21
7.3.1.2 August Events	22
7.4 Oregon Chub	22
7.5 Analysis of High Turbidity on Spawning Gravel	23
7.6 Analysis of High Turbidity on Aquatic Macroinvertebrates	24
7.7 Analysis of High Turbidity on Fishes	28
7.8 Analysis of Tunnel Tap and Drawdown Events	30
8.0 EFFECTS OF PROJECT ACTIVITIES NOT PREVIOUSLY EVALUATED	31
8.1 Turbidity	31
8.2 DDT in Sediment	33
8.3 Spawning Gravel	33
8.4 Macroinvertebrates	34
8.5 Fisheries	34
8.6 Socio-Economics	34
8.7 EWEB	35
9.0 ENVIRONMENTAL EVALUATIONS AND COORDINATION ...	36
9.1 Evaluation/Mitigation	36
9.2 Significance	36
9.3 Coordination	37
10.0 FINDINGS AND RECOMMENDATIONS	37
10.1 Findings	37
10.2 Recommendations	38
11.0 REFERENCES	40

TABLES

	Page
Table 1. Water Quality Samples	6
Table 2. Grain Size Characteristics of Sediment	10
Table 3. Cougar SIR Operational Alternative Plans	13
Table 4. Cougar Pool Elevations, 10-90 Percent Non-Exceedance	15
Table 5. Biotic and Habitat Integrity Index Summary	27

FIGURES

Figure 1. Willamette Basin Location Map	2
Figure 2. Discharge and Turbidity at Gage 0.5 Miles Downstream	7
Figure 3. Discharge and Turbidity at Gage Upstream of the Dam	8
Figure 4. Macro-invertebrate Sampling Sites	25
Figure 5. Plot of Biotic and Habitat Integrity Index Scores	26

APPENDICES

Appendix A Water Quality

Appendix B Sediment Quality Evaluation

Appendix C Operational Alternatives – Technical Summary

Appendix D Sediment Concentrations and Discharge Computations

blank